# Suisun Marsh Monitoring Program Channel Water Salinity Report

Reporting Period: May 2006

Questions regarding this report should be directed to:

# Jim Sung

California Department of Water Resources
Division of Environmental Services
3251 S Street
Sacramento, CA 95816-7017

Telephone: (916) 227-7520 sung@water.ca.gov

## **TABLE OF CONTENT**

1.	SUISUN MARSH MONITORING STATIONS AND REPORTING REQUIREMENT	REPORTING REQUIREMENT1	
2.	MONITORING RESULTS	2	
	2.1 CHANNEL WATER SALINITY COMPLIANCE	2	
	2.2 DELTA OUTFLOW	2	
	2.4 SUISUN MARSH SALINITY CONTROL GATE (SMSCG) OPERATIONS		
3.	DISCUSSION	3	
	3.1 FACTORS AFFECTING CHANNEL WATER SALINITY IN THE SUISUN MARSH	3	
	3.2 OBSERVATIONS AND TRENDS	4	
	3.2.1 Conditions during the Reporting Period	4	
	3.2.2 Comparison of Reporting Period Conditions with Previous Years	4	
4.	List of Figures		
	Figure 1: Suisun Marsh Progressive Mean High Tide Specific Conductance for compliance stations		
	Figure 2: Suisun Marsh Progressive Mean High Tide Specific Conductance for monitoring stations		
	Figure 3: Daily Net Delta Outflow Index and Precipitation		
	Figure 4: 10-yr Comparison of Monthly Values of Monthly Mean Specific Conductance at High Tide for		

Figure 5: Map of compliance and monitoring stations, and control facilities in Suisun Marsh

compliance and monitoring stations

#### 1. SUISUN MARSH MONITORING STATIONS AND REPORTING REQUIREMENT

As per SWRCB Water Rights Decision 1641, dated December 29, 1999, and previous SWRCB decisions, the California Department of Water Resources (DWR) is required to provide monthly channel water salinity compliance reports for the Suisun Marsh to the SWRCB. Conditions of channel water salinity in the Suisun Marsh are determined by monitoring specific electrical conductivity, which is referred as "specific conductance" (SC). The locations of all listed stations are shown in Figure 5.

The monthly reports are submitted for October through May each year in accordance with SWRCB requirements. The reports are required to include salinity data from the stations listed below to ensure salinity standards are met to protect habitat for waterfowl in managed wetlands:

Station Identification	Station Name	General Location	Classification
C-2*	Collinsville	Western Delta	Compliance Station
S-64	National Steel	Eastern Suisun Marsh	Compliance Station
S-49	Beldon's Landing	North-Central Suisun Marsh	Compliance Station
S-42	Volanti	North-Western Suisun Marsh	Compliance Station
S-21	Sunrise	North-Western Suisun Marsh	Compliance Station

Data from the stations listed below are included in the monthly reports to provide information on salinity conditions in the western Suisun Marsh.

Station Identification	Station Name	General Location	Classification
S-97	Ibis	Western Suisun Marsh	Monitoring Station
S-35	Morrow Island	South-Western Suisun Marsh	Monitoring Station

Information on Delta outflow, area rainfall, and operation of the Suisun Marsh Salinity Control Gates are also included in the monthly reports to provide information on conditions that may affect channel water salinity in the Marsh.

<sup>\*</sup> Throughout the report, the representative data from nearby USBR station is used in lieu of data from station C-2.

## 2. Monitoring Results

# 2.1 Channel Water Salinity Compliance

During the month of May, 2006, salinity conditions at all five compliance stations are in compliance with channel water salinity standards of SWRCB (Table 1). Compliance with standards for the month of May was determined for each compliance station by comparing the progressive daily mean of high-tide SC with respective standards. The standard for compliance stations C-2, S-64, S-49, S-42 and S-21 are 11.0 mS/cm during May 2006. Table 1 lists monthly mean high-tide SC at these compliance stations. The progressive daily mean (PDM) is the monthly average of both daily high-tide SC values. The mathematical equation is shown below.

#### 2.2 Delta Outflow

Outflow for May 2006 was still a record high despite lower flow values than prior month range. Outflow ranged between 50,000 cfs and 130,000 cfs during the month. The lowest outflow was at the end of the month, whereas the largest outflow was at the beginning of the month, 51,000 cfs and 126,000, respectively. Although outflow in May declined from beginning to end of month, outflow magnitude remains very high as a result of continued high outflow carry over from previous months. The monthly Delta outflow is represented by the mean Net Delta Outflow Index (NDOI). The NDOI is the estimated daily average of Delta outflow. Mean NDOI for May 2006 is listed below:

Month	Mean NDOI (cubic feet per second)	
May	84,586	

#### 2.3 Rainfall

The May rainfall total of 0.6 inches was much lower than previous two months, but was normal and as expected for the month of May. Only three days of precipitation occurred in May; between May 20 and May 24. The largest precipitation occurred on May 22, with a daily total of 0.6 inches.

Month	Total Rainfall (inches)
May	0.6

## 2.4 Suisun Marsh Salinity Control Gate (SMSCG) Operations

Operations and flashboard/boat lock installations at the SMSCG during May 2006 is summarized below.

Date	Gate status	Flashboards status	Boat Lock status
May 1 – 31	Open	Out	Open

Due to continued high outflows in May 2006, salinity levels in marsh remained extremely low and gates remained inoperable with flashboards still out of the maintenance channel. DWR will continue to monitor salinity levels in the marsh and will re-operate the gates and install the flashboards if conditions warrant, however, based on current hydrologic conditions and past experiences, more than likely the gates will not be operational for the remainder of the control season.

#### 3. Discussion

# 3.1 Factors Affecting Channel Water Salinity in the Suisun Marsh

Factors that affect channel water salinity levels in the Suisun Marsh include:

- delta outflow;
- tidal exchange;
- rainfall and local creek inflow;
- managed wetland operations; and,
- operation of the SMSCG and flashboard configurations.

### 3.2 Observations and Trends

# 3.2.1 Conditions during the Reporting Period

During May 2006, salinity levels at Collinsville(C-2), National Steel(S-64), Beldons (S-49), and Volanti(S-42) were all below 1.0 mS/cm as shown in Figure 1. Salinity levels throughout May remained flat line because salinity level has reached the maximum freshness. As for the two monitoring stations, S-35 and S-97, salinity levels remained below 2.0 mS/cm as shown in Figure 2. These monitoring stations salinity levels were slightly higher in magnitude than all the compliance stations salinity levels due to their proximity and being less influenced by outflow, but all stations had very little to no salinity fluctuation throughout May because salinity levels have reached its maximum freshness resulting from the continued high outflows observed in May.

S-21 (Sunrise Club) continued to be inaccessible since late December 2005 due to flooded roadways, thus data was not available to report at S-21 station. However, given the extremely low salinity levels throughout the marsh, standard at S-21 was more than likely met.

Overall, salinity levels in May 2006 were well below standards at all compliance and monitoring stations.

## 3.2.2 Comparison of Reporting Period Conditions with Previous Years

Monthly mean high-tide SC at the compliance and monitoring stations for May 2006 were compared with means for those months during the previous nine years (Figure 4).

Mean salinity pattern of all compliance and monitoring stations resembles that of 1999, but lower in magnitude, except for C-2. Compared to previous nine years, May 2006 salinity levels were ranked tenth in high Specific Conductance, thus making it the month with the lowest salinity levels.

Table 1

Monthly Mean High Tide Specific Conductance at Suisun Marsh
Water Quality Compliance Stations

# May 2006

Station	Specific Conductance (mS/cm)*	Standard	Standard meet?
C-2**	0.3	11.0	Yes
S-64	0.2	11.0	Yes
S-49	0.4	11.0	Yes
S-42	0.8	11.0	Yes
S-21***	n/a	11.0	Yes

<sup>\*</sup>milliSiemens per centimeter


<sup>\*\*</sup>The representative data from nearby USBR station is used in lieu of data from station C-2.

<sup>\*\*\*</sup>station data was not accessible due to flood water, thus salinity information is not reported. However, salinity levels throughout the marsh was so fresh that standard at this station was likely met.

Channel Water Salinity Report

May 2004

Figure 1. Suisun Marsh Progressive Mean High Tide Specific Conductance
May 2006

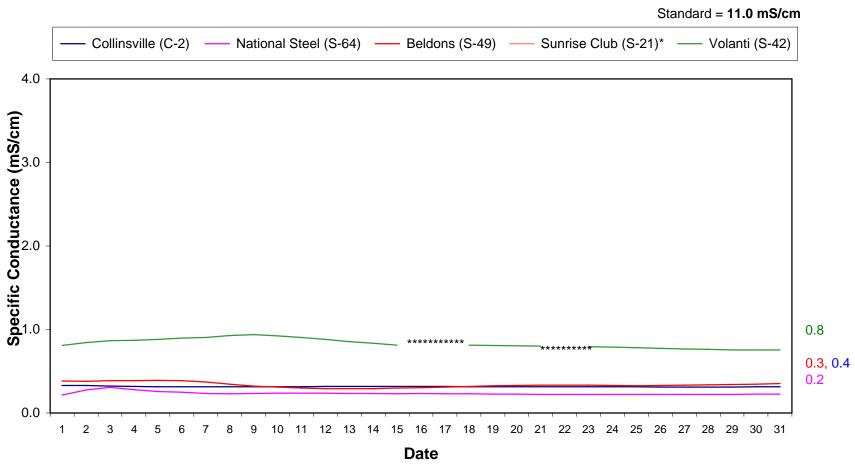


\*S21 data not available due to inaccessible road.
\*\*\*\*\*\*\*\*\*\* Missing data due to equipment failure at S-42.


Channel Water Salinity Report

May 2004

Figure 2. Suisun Marsh Progressive Mean High Tide Specific Conductance May 2006

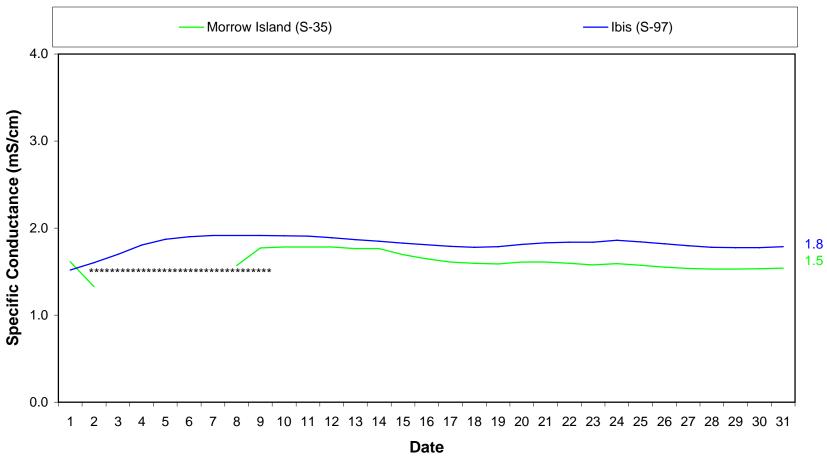

\*\*\*\*\*\*\* Missing data due to equipment failure at S-35.

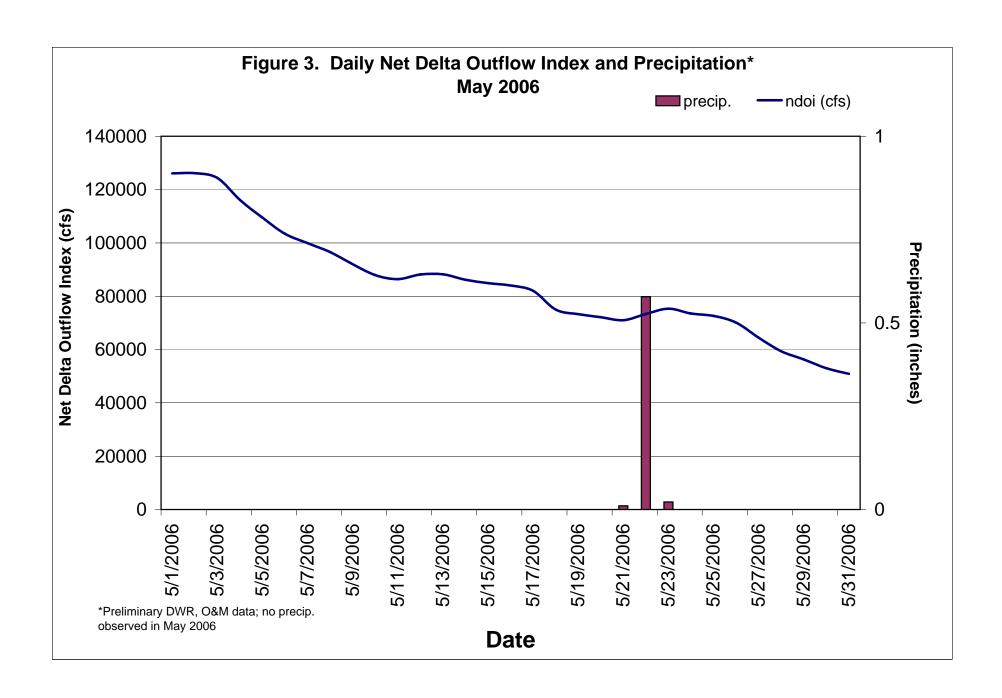

Channel Water Salinity Report

May 2004


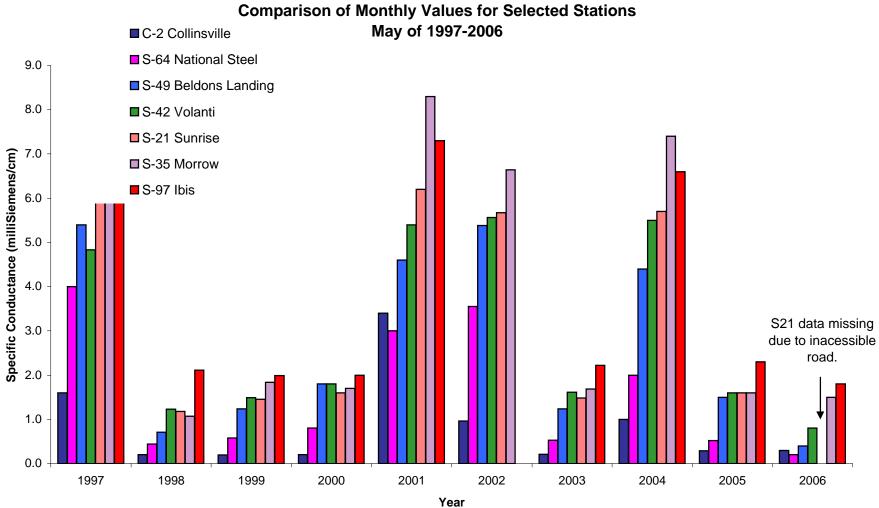


Figure 4. Monthly Mean Specific Conductance at High Tide:
Comparison of Monthly Values for Selected Stations

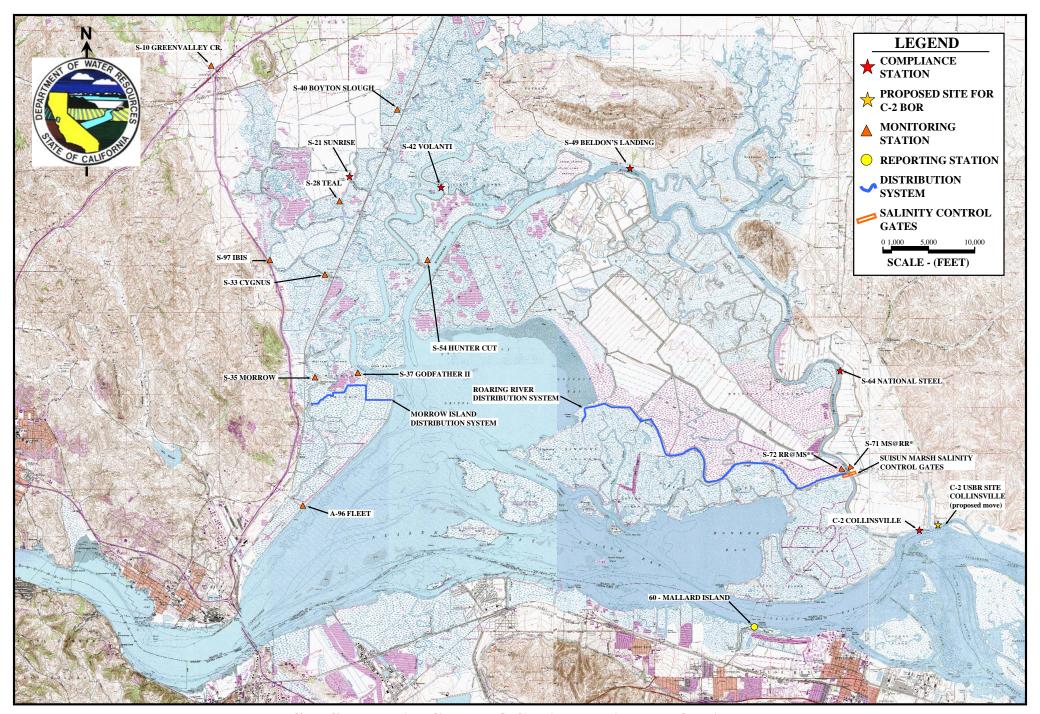

SUISUN MARSH PROGRAM WATER QUALITY MONITORING AND CONTROL FACILITIES